



# Service Bulletin

## DCA400 Fuel Return Modification

<b>Product Group:</b> Power Solutions	<b>Date Issued:</b> 01/13/11	<b>Service Bulletin No.</b> GSP20110113
<b>Bulletin Type</b> <input checked="" type="checkbox"/> Mandatory <input type="checkbox"/> Information Only <input type="checkbox"/> Recommended Change		<b>Models/Series Affected:</b> <b>DCA400 SERIES</b> <b>TRAILER MOUNTED UNITS</b> <b>S/N 3838596 – 3842955</b>

### Details


#### Problem:

The engine return line delivers more fuel than can be displaced by the generator fuel tank to the trailer fuel tank, causing the generator fuel tank to overfill and leak fuel through the fuel tank cap.

#### Solution:

Route engine fuel return line directly to the trailer tank.

### Parts Information

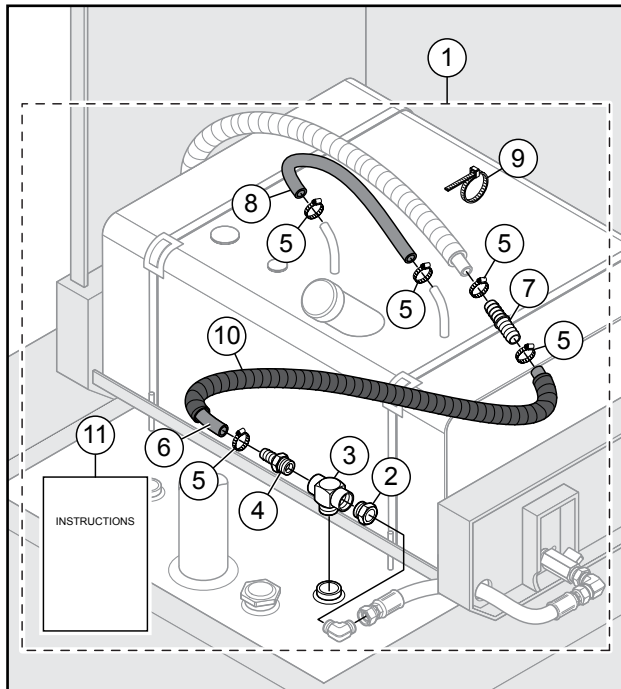

Item No.	Part No.	Description	QTY.	Remarks
1	35500	Kit, Return Fuel Line	1	Includes items 2-11
2		Fitting, Bush 1/2FP x 3/4MP Steel/ Yel Zinc	1	
3		Fitting, Tee, 3/4FP x 3/4MP x 3/4FP	1	
4		Fitting, 3/4MP x 1/2 Barb, Brass	1	
5		Clamp, Hose Worm #8 1/2-1.00	5	
6		Hose, Fuel, 1/2" ID, Return Extension, 53 in. (134.6 cm)	1	
7		Fitting, Brass, 8 Barb x 8 Barb	1	
8		Hose, Fuel, 1/2" ID, Vent, 24 in. (61 cm)	1	
9		Tie, Cable Ty-Rap Black	6	
10		Protector, Spiral Hose	1	
11	35499	Instructions, Return Fuel Line	1	



# Service Bulletin

## DCA400 Fuel Return Modification

# HERE'S HOW TO GET HELP

PLEASE HAVE THE MODEL AND SERIAL  
NUMBER ON-HAND WHEN CALLING

### UNITED STATES

#### *MultiQuip Corporate Office*

18910 Wilmington Ave.      Tel. (800) 421-1244  
Carson, CA 90746      Fax (800) 537-3927  
Contact: mq@multiquip.com

#### *Service Department*

800-421-1244      Fax: 310-537-4259  
310-537-3700

#### *Technical Assistance*

800-478-1244      Fax: 310-943-2238

#### *MQ Parts Department*

800-427-1244      Fax: 800-672-7877  
310-537-3700      Fax: 310-637-3284

#### *Warranty Department*

800-421-1244      Fax: 310-943-2249  
310-537-3700

### MEXICO

#### *MQ Cipsa*

Carr. Fed. Mexico-Puebla KM 126.5      Tel: (52) 222-225-9900  
Momoxpan, Cholula, Puebla 72760 Mexico      Fax: (52) 222-285-0420  
Contact: pmastretta@cipsa.com.mx

### CANADA

#### *MultiQuip*

4110 Industriel Boul.      Tel: (450) 625-2244  
Laval, Quebec, Canada H7L 6V3      Tel: (877) 963-4411  
Contact: jmartin@multiquip.com      Fax: (450) 625-8664

### UNITED KINGDOM

#### *MultiQuip (UK) Limited Head Office*

Unit 2, Northpoint Industrial Estate,      Tel: 0161 339 2223  
Globe Lane,      Fax: 0161 339 3226  
Dukinfield, Cheshire SK16 4UJ  
Contact: sales@multiquip.co.uk

© COPYRIGHT 2011, MULTIQUIP INC.

MultiQuip Inc and the MQ logo are registered trademarks of MultiQuip Inc. and may not be used, reproduced, or altered without written permission. All other trademarks are the property of their respective owners and used with permission.

The information and specifications included in this publication were in effect at the time of approval for printing. Illustrations, descriptions, references and technical data contained in this document are for guidance only and may not be considered as binding. MultiQuip Inc. reserves the right to discontinue or change specifications, design or the information published in this publication at any time without notice and without incurring any obligations.

Your Local Dealer is:

